

OPERATING INSTRUCTIONS



Translation of the Original

PCR 280

Pirani/capacitive gauge



Dear Customer,

Thank you for choosing a Pfeiffer Vacuum product. Your new gauge is designed to support you in your individual application with maximum performance and without malfunctions. The name Pfeiffer Vacuum stands for high-quality vacuum technology, a comprehensive and complete range of top-quality products and first-class service. From this extensive, practical experience we have gained a large volume of information that can contribute to efficient deployment and to your personal safety.

In the knowledge that our product must avoid consuming work output, we trust that our product can offer you a solution that supports you in the effective and trouble-free implementation of your individual application.

Please read these operating instructions before putting your product into operation for the first time. If you have any questions or suggestions, please feel free to contact info@pfeiffer-vacuum.de.

Further operating instructions from Pfeiffer Vacuum can be found in the <u>Download Center</u> on our website.

Disclaimer of liability

These operating instructions describe all models and variants of your product. Note that your product may not be equipped with all features described in this document. Pfeiffer Vacuum constantly adapts its products to the latest state of the art without prior notice. Please take into account that online operating instructions can deviate from the printed operating instructions supplied with your product.

Furthermore, Pfeiffer Vacuum assumes no responsibility or liability for damage resulting from the use of the product that contradicts its proper use or is explicitly defined as foreseeable misuse.

Copyright

This document is the intellectual property of Pfeiffer Vacuum and all contents of this document are protected by copyright. They may not be copied, altered, reproduced or published without the prior written permission of Pfeiffer Vacuum.

We reserve the right to make changes to the technical data and information in this document.

Table of contents

| 1 | Abo | ut this manual | 7 |
|----|------------|----------------------------------------------------------|----------|
| | 1.1 | Validity | 7 |
| | | 1.1.1 Applicable documents | 7 |
| | | 1.1.2 Variants | 7 |
| | 1.2 | Target group | 7 |
| | 1.3 | Conventions | 8 |
| | | 1.3.1 Instructions in the text | 8 |
| | | 1.3.2 Pictographs | 8 |
| | | 1.3.3 Stickers on the product | 8 |
| | | 1.3.4 Abbreviations | 8 |
| | 1.4 | Trademark proof | 9 |
| 2 | Safe | etv | 10 |
| _ | 2.1 | General safety information | 10 |
| | 2.2 | Safety instructions | 10 |
| | 2.3 | Safety precautions | 12 |
| | 2.4 | Proper use | 12 |
| | 2.5 | Foreseeable improper use | 13 |
| | 2.6 | Responsibilities and warranty | 13 |
| | 2.7 | Owner requirements | 13 |
| | 2.8 | Personnel qualification | 13 |
| | | 2.8.1 Ensuring personnel qualification | 13 |
| | | 2.8.2 Personnel qualification for maintenance and repair | 14 |
| | | 2.8.3 Advanced training with Pfeiffer Vacuum | 14 |
| | 2.9 | Operator requirements | 14 |
| 3 | Pro | duct description | 15 |
| | 3.1 | | 15 |
| | 3.2 | Status display | 15 |
| | 3.3 | | 15 |
| | 3.4 | Scope of delivery | 15 |
| 4 | Trar | sport and storage | 16 |
| 7 | 4.1 | Transporting the product | 16 |
| | 4.2 | Storing the product | 16 |
| | ⊤.∠ | Clothing the product | 10 |
| 5 | | allation | 17 |
| | 5.1 | Establishing the vacuum connection | 17 |
| | 5.2 | Establishing the electric connection | 18 |
| 6 | Ope | ration | 21 |
| | 6.1 | Converting measuring signal and pressure | 21 |
| | 6.2 | Ascertaining effective pressure with calibration factors | 22 |
| 7 | Disa | assembly | 24 |
| 8 | • | | 0.0 |
| 0 | | ntenance Calibrating the gauge | 26 |
| | 8.1 8.2 | Calibrating the gauge | 26 27 |
| | 8.3 | Cleaning of components Disassembling the gauge | 28 |
| | 8.4 | Assembling the gauge | 29 |
| | 0.4 | Assembling the gauge | 28 |
| 9 | | unctions | 31 |
| | 9.1 | Troubleshooting | 31 |
| | 9.2 | Detecting errors on the measurement system | 31 |
| 10 | Shir | pping | 33 |
| | | 17 11 123 | |

| 11 | Recycling and disposal | 34 |
|----|--------------------------------------|----|
| | 11.1 General disposal information | 34 |
| | 11.2 Dispose of gauges | 34 |
| 12 | Service solutions by Pfeiffer Vacuum | 35 |
| 13 | Spare parts | 37 |
| 14 | Accessories | 38 |
| | 14.1 Accessory information | 38 |
| | 14.2 Ordering accessories | 38 |
| 15 | Technical data and dimensions | 39 |
| | 15.1 General | 39 |
| | 15.2 Technical data | 39 |
| | 15.3 Dimensions | 41 |
| | ETL certification | 42 |
| | Declaration of conformity | 43 |

List of tables

| Tbl. 1: | Applicable documents | 7 |
|----------|-----------------------------------------------------------|----|
| Tbl. 2: | Variants | 7 |
| Tbl. 3: | Abbreviations used | 9 |
| Tbl. 4: | LED "Status" | 15 |
| Tbl. 5: | Constants for converting measuring signal and pressure | 21 |
| Tbl. 6: | Gas type dependence | 23 |
| Tbl. 7: | Calibration factors for the Pirani pressure range < 1 hPa | 23 |
| Tbl. 8: | Malfunctions | 31 |
| Tbl. 9: | Measurement | 32 |
| Tbl. 10: | Conversion table: Pressure units | 39 |
| Tbl. 11: | Conversion table: Units for gas throughput | 39 |
| Tbl. 12: | Measured and pressure values | 39 |
| Tbl. 13: | Electrical data | 40 |
| Tbl. 14: | Internal volume and weight | 40 |
| Tbl. 15: | Ambient conditions | 40 |
| Tbl. 16: | Temperatures | 40 |
| Tbl. 17: | Substances in contact with the media | 41 |

List of figures

| Fig. 1: | Light emitting diode | 15 |
|----------|------------------------------------------------|----|
| Fig. 2: | Establishing the vacuum connection | 18 |
| Fig. 3: | Connection diagram | 19 |
| Fig. 4: | Measurement cable and Hirschmann cable socket | 19 |
| Fig. 5: | Relation between measuring signal and pressure | 21 |
| Fig. 6: | Gas type dependence | 22 |
| Fig. 7: | Disassembling the gauge | 25 |
| Fig. 8: | Calibrating the gauge | 27 |
| Fig. 9: | Disassembling the gauge | 29 |
| Fig. 10: | Assembling the gauge | 30 |
| Fig. 11: | Contact pins of the measurement system | 32 |
| Fig. 12: | Dimensions | 41 |

1 About this manual



IMPORTANT

Read carefully before use.

Keep the manual for future consultation.

1.1 Validity

This document describes the function of the products listed in the following and provides the most important information for safe use. The description is written in accordance with the valid directives. The information in this document refers to the current development status of the products. The document retains its validity assuming that the customer does not make any changes to the product.

1.1.1 Applicable documents

| Designation | Document |
|--------------------------------------------------------------------------------------|-----------------------------------|
| Operating instructions "Total pressure measuring and control unit" TPG 361 TPG 362 | BG 5500 |
| Operating instructions "Total pressure measuring and control unit" TPG 366 | BG 5501 |
| Declaration of conformity | (Component of these instructions) |

Tbl. 1: Applicable documents

You can find these documents in the Pfeiffer Vacuum Download Center.

1.1.2 Variants

This document applies to products with the following part numbers:

| Part number | Designation |
|-------------|------------------------|
| PT R26 855 | PCR 280 (DN 16 ISO-KF) |
| PT R26 856 | PCR 280 (DN 16 CF-F) |

Tbl. 2: Variants

You can find the part number on the rating plate of the product.

Pfeiffer Vacuum reserves the right to make technical changes without prior notification.

Information that relates to only one of the products is indicated accordingly.

The figures in this document are not to scale.

The figures show the product with a DN 16 ISO-KF vacuum connection, however, they also apply to the other vacuum connection.

Dimensions are in mm unless stated otherwise.

1.2 Target group

These operating instructions are aimed at all persons performing the following activities on the product:

- Transportation
- Setup (Installation)
- Usage and operation
- Decommissioning
- Maintenance and cleaning
- Storage or disposal

The work described in this document is only permitted to be performed by persons with the appropriate technical qualifications (expert personnel) or who have received the relevant training from Pfeiffer Vacuum.

1.3 Conventions

1.3.1 Instructions in the text

Usage instructions in the document follow a general structure that is complete in itself. The required action is indicated by an individual step or multi-part action steps.

Individual action step

A horizontal, solid triangle indicates the only step in an action.

► This is an individual action step.

Sequence of multi-part action steps

The numerical list indicates an action with multiple necessary steps.

- 1. Step 1
- 2. Step 2
- 3. ...

1.3.2 Pictographs

The pictographs used in the document indicate useful information.



Note



Tip




Wear laboratory gloves



Perform a visual inspection

1.3.3 Stickers on the product

This section describes all the stickers on the product along with their meaning.

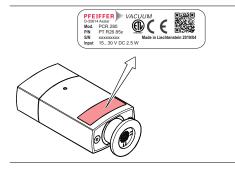

Rating plate

The rating plate is located on the back of the device.

1.3.4 Abbreviations

| Abbreviation | Explanation |
|--------------|--------------------------------------------------------------------------|
| ADJ | Adjust |
| ATM | Atmosphere |
| С | Constant for converting measuring signal and pressure |
| С | Calibration factor for calculating the pressure for gases other than air |
| HV | High vacuum |
| LPS | Limited power source |
| MSL | Mean sea level |
| р | Pressure |

| Abbreviation | Explanation |
|--------------|---------------------------------------|
| ST | Status |
| WAF | width across flats |
| U | Measuring signal [V] (output voltage) |

Tbl. 3: Abbreviations used

1.4 Trademark proof

 $\bullet \hspace{0.3cm} \mbox{Hirschmann}^{\mbox{\tiny @}}$ is a trademark of Hirschmann Electronics GmbH.

2 Safety

2.1 General safety information

The following 4 risk levels and 1 information level are taken into account in this document.

A DANGER

Immediately pending danger

Indicates an immediately pending danger that will result in death or serious injury if not observed.

Instructions to avoid the danger situation

WARNING

Potential pending danger

Indicates a pending danger that could result in death or serious injury if not observed.

► Instructions to avoid the danger situation

A CAUTION

Potential pending danger

Indicates a pending danger that could result in minor injuries if not observed.

Instructions to avoid the danger situation

NOTICE

Danger of damage to property

Is used to highlight actions that are not associated with personal injury.

Instructions to avoid damage to property



Notes, tips or examples indicate important information about the product or about this document.

2.2 Safety instructions



Safety instructions according to product's life stages

All safety instructions in this document are based on the results of a risk assessment. Pfeiffer Vacuum has taken into account all the relevant life stages of the product.

Risks during installation

A DANGER

Risk to life due to electric shock

An improperly earthed product is potentially fatal in the event of a fault.

- ► Connect the product galvanically with the earthed vacuum chamber.
- ► Ensure that the connection complies with the requirements of a protective bonding according to EN 61010. (CF and VCR connections comply with this requirement.)
- ▶ Use electrically conductive centering rings and circlips for KF connections.

A DANGER

Danger to life due to dangerous contact voltage

Voltages above 30 V (AC) or 60 V (DC) are considered dangerous in accordance with EN 61010. If you come into contact with dangerous contact voltage, this can result in injury through electric shocks or even death.

- Only connect the product to devices which meet the following criteria:
 - Requirements of the earthed protective extra-low voltage (PELV)
 - Limited power source (LPS) Class 2
- Secure the line to the product.
 - Pfeiffer Vacuum measuring and control equipment complies with this requirement.

WARNING

Risk of injury resulting from overpressure in the vacuum system

Opening tensioning pieces with an overpressure > 1000 hPa in the vacuum system can lead to injuries as a result of flying parts, and escaping process medium could prove harmful to health.

Elastomer seals in KF connections (e.g. O-rings) are not resistant to pressures > **2500 hPa**. This could prove harmful to health due to escaping process medium.

- ▶ Do not open any tensioning pieces when overpressure is prevalent in the vacuum system.
- ► Use suitable tensioning pieces for overpressure.
- Use tensioning pieces which can only be opened and closed using a tool (e.g. tightening strap-circlip).
- Use sealing rings with an outer centering ring.

Risks during maintenance

A DANGER

Electric shocks due to moisture penetrating into the device

Moisture that has penetrated into the device results in personal injury through electric shocks.

- ▶ Only operate the device in a dry environment.
- Operate the device away from fluids and humidity sources.
- Do not switch on the device if fluid has penetrated into it, instead contact Pfeiffer Vacuum Service.
- ► Always disconnect the current supply before cleaning the device.

WARNING

Health hazard through poisoning from toxic contaminated components or devices

Toxic process media result in contamination of devices or parts of them. During maintenance work, there is a risk to health from contact with these poisonous substances. Illegal disposal of toxic substances causes environmental damage.

- Take suitable safety precautions and prevent health hazards or environmental pollution by toxic process media.
- Decontaminate affected parts before carrying out maintenance work.
- Wear protective equipment.

Risks when shipping

WARNING

Risk of poisoning from contaminated products

Where products that contain harmful substances are shipped for maintenance or repair purposes, the safety of service personnel is at risk.

Comply with the instructions for safe shipping.

Risks during disposal

WARNING

Health hazard through poisoning from toxic contaminated components or devices

Toxic process media result in contamination of devices or parts of them. During maintenance work, there is a risk to health from contact with these poisonous substances. Illegal disposal of toxic substances causes environmental damage.

- ► Take suitable safety precautions and prevent health hazards or environmental pollution by toxic process media.
- Decontaminate affected parts before carrying out maintenance work.
- Wear protective equipment.

2.3 Safety precautions

The product is designed according to the latest technology and recognized safety engineering rules. Nevertheless, improper use can result in danger to operator all third party life and limb, and product damage and additional property damage.



Duty to provide information on potential dangers

The product holder or user is obliged to make all operating personnel aware of dangers posed by this product.

Every person who is involved in the installation, operation or maintenance of the product must read, understand and adhere to the safety-related parts of this document.



Infringement of conformity due to modifications to the product

The Declaration of Conformity from the manufacturer is no longer valid if the operator changes the original product or installs additional equipment.

Following the installation into a system, the operator is required to check and re-evaluate the conformity of the overall system in the context of the relevant European Directives, before commissioning that system.

General safety precautions when handling the product

- Observe all applicable safety and accident prevention regulations.
- ▶ Check that all safety measures are observed at regular intervals.
- Pass on safety instructions to all other users.
- ▶ Do not expose body parts to the vacuum.
- Always ensure a secure connection to the earthed conductor (PE).
- ► Never disconnect plug connections during operation.
- ► Observe the above shutdown procedures.
- ► Keep lines and cables away from hot surfaces (> 70 °C).
- Do not carry out your own conversions or modifications on the device.
- ▶ Observe the unit protection degree prior to installation or operation in other environments.
- ▶ Provide suitable touch protection, if the surface temperature exceeds 70 °C.
- Inform yourself about any contamination before starting work.

2.4 Proper use

The gauge provides a vacuum measurement of gases within the range of 5 × 10-5 up to 1500 hPa.

Use the product according to its intended purpose

- ▶ Operate the gauge with a Pfeiffer Vacuum total pressure measuring and control unit or with an evaluation unit provided by the customer.
- ▶ Install, operate and maintain the gauge exclusively as prescribed in these operating instructions.
- Observe the application limits prescribed in the technical data.
- Observe the technical data.

2.5 Foreseeable improper use

Improper use of the product invalidates all warranty and liability claims. Any use that is counter to the purpose of the product, whether intentional or unintentional, is regarded as misuse, in particular:

- Use outside the mechanical and electrical application limits
- Use with corrosive or explosive media, if this is not explicitly permitted
- Use for the measurement of highly flammable or combustible gases mixed with an oxidizing agent (e.g. atmospheric oxygen) within the explosion limits
- Use outdoors
- Use after technical changes (on the inside or the outside of the product)
- · Use with replacement or accessory parts that are unsuitable or are not approved

2.6 Responsibilities and warranty

Pfeiffer Vacuum shall assume no responsibilities and warranty if the operating company or a third party:

- disregards this document
- · does not use the product for its intended purpose
- carries out any modifications to the product (conversions, changes, etc.) that are not listed in the corresponding product documentation
- operates the product with accessories that are not listed in the corresponding product documentation

The operator is responsible for the process media used.

2.7 Owner requirements

Safety-conscious working

- 1. Only operate the product in a technically flawless state.
- Operate the product in line with its intended purpose, safety and hazard-conscious and only in compliance with these operating instructions.
- 3. Fulfill the following instructions and monitor the observation of the following instructions:
 - Proper use
 - Generally applicable safety instructions and accident prevention regulations
 - International, national and locally applicable standards and guidelines
 - Additional product-related guidelines and regulations
- 4. Only use original parts or parts approved by Pfeiffer Vacuum.
- 5. Keep the operating instructions available at the place of installation.
- 6. Ensure personnel qualification.

2.8 Personnel qualification

The work described in this document may only be carried out by persons who have appropriate professional qualifications and the necessary experience or who have completed the necessary training as provided by Pfeiffer Vacuum.

Training people

- 1. Train the technical personnel on the product.
- 2. Only let personnel to be trained work with and on the product when under the supervision of trained personnel.
- 3. Only allow trained technical personnel to work with the product.
- 4. Before starting work, make sure that the commissioned personnel have read and understood these operating instructions and all applicable documents, in particular the safety, maintenance and repair information.

2.8.1 Ensuring personnel qualification

Specialist for mechanical work

Only a trained specialist may carry out mechanical work. Within the meaning of this document, specialists are people responsible for construction, mechanical installation, troubleshooting and maintenance of the product, and who have the following qualifications:

- · Qualification in the mechanical field in accordance with nationally applicable regulations
- Knowledge of this documentation

Specialist for electrotechnical work

Only a trained electrician may carry out electrical engineering work. Within the meaning of this document, electricians are people responsible for electrical installation, commissioning, troubleshooting, and maintenance of the product, and who have the following qualifications:

- · Qualification in the electrical engineering field in accordance with nationally applicable regulations
- Knowledge of this documentation

In addition, these individuals must be familiar with applicable safety regulations and laws, as well as the other standards, guidelines, and laws referred to in this documentation. The above individuals must have an explicitly granted operational authorization to commission, program, configure, mark, and earth devices, systems, and circuits in accordance with safety technology standards.

Trained individuals

Only adequately trained individuals may carry out all works in other transport, storage, operation and disposal fields. Such training must ensure that individuals are capable of carrying out the required activities and work steps safely and properly.

2.8.2 Personnel qualification for maintenance and repair



Advanced training courses

Pfeiffer Vacuum offers advanced training courses to maintenance levels 2 and 3.

Adequately trained individuals are:

- Maintenance level 1
 - Customer (trained specialist)
- Maintenance level 2
 - Customer with technical education
 - Pfeiffer Vacuum service technician
- Maintenance level 3
 - Customer with Pfeiffer Vacuum service training
 - Pfeiffer Vacuum service technician

2.8.3 Advanced training with Pfeiffer Vacuum

For optimal and trouble-free use of this product, Pfeiffer Vacuum offers a comprehensive range of courses and technical trainings.

For more information, please contact Pfeiffer Vacuum technical training.

2.9 Operator requirements

Observing relevant documents and data

- 1. Read, observe and follow this operating instruction and the work instructions prepared by the operating company, in particular the safety and warning instructions.
- Install, operate and maintain the product only in accordance with these operating instructions.
- Carry out all work only on the basis of the complete operating instructions and applicable documents.
- 4. Comply with the application limits.
- 5. Observe the technical data.
- Please contact the Pfeiffer Vacuum Service Center if your questions on operation or maintenance of the product are not answered by these operating instructions.
 - You can find information in the <u>Pfeiffer Vacuum service area</u>.

3 Product description

3.1 Function

The gauge has a Pirani sensor and a capacitive diaphragm sensor. Both sensors are always active. For low pressures, the unit only uses the signal from the Pirani sensor for the pressure measurement. For high pressures, the unit only uses the signal of the capacitive diaphragm sensor. In a mixed range, the unit weights both signals proportional to the pressure and determines the output signal on this basis.

3.2 Status display

 


Fig. 1: Light emitting diode

1 For factory setting only

2 LED "Status" (ST)

| Condition | Meaning |
|--------------------------|-----------------|
| Off | No power supply |
| Lights up green | Measuring mode |
| Lights up or flashes red | Error |

Tbl. 4: LED "Status"

3.3 Identifying the product

You will need all the data from the rating plate to safely identify the product when communicating with Pfeiffer Vacuum.

- 1. Read the data on the product rating plate.
- 2. Record this data.
- 3. Always have all rating plate specifications to hand.

3.4 Scope of delivery

The shipment includes the following parts:

- Gauge
- Stylus (Ø 1.1 mm)
- · Operating instructions

Unpacking the product and checking completeness of the shipment

- 1. Unpack the product.
- 2. Remove the transport fasteners, transport protection etc.
- 3. Store the transport fasteners, transport protection etc. in a safe place.
- 4. Check that the shipment is complete.
- 5. Ensure that no parts are damaged.

4 Transport and storage

4.1 Transporting the product

NOTICE

Damage caused by incorrect transportation

Transportation in unsuitable packaging, or failure to install all transport locks, can damage the product.

► Comply with the instructions for safe transportation.



Packing

We recommend keeping the transport packaging and original protective cover.

General information regarding safe transport

- ▶ Observe the weight specified on the transport packaging.
- ▶ Where possible, always transport or ship the product in the original transport packaging.
- ▶ Always use dense and impact-proof transport packaging for the product.
- Remove the existing protective cover and transport protections only immediately prior to installation
- Reattach transport locks and transport protections prior to each transport.

4.2 Storing the product

NOTICE

Damage caused by improper storage

Improper storage will lead to damage to the product.

Static charging, moisture, etc. lead to defects on the electronic components.

► Comply with the instructions for safe storage.



Packing

We recommend storing the product in its original packaging.

General information for safe storage

- ► Store the product in a cool, dry, dust-free place, where it is protected against impacts and mechanical vibration.
- ► Always use dense and impact-proof packaging for the product.
- ▶ Where possible, store the product in its original packaging.
- ► Store electronic components in antistatic packaging.
- ► Maintain the permissible storage temperature.
- ► Avoid extreme fluctuations of the ambient temperature.
- Avoid high air humidity.
- ► Seal connections with the original protective caps.
- ▶ Protect the product with the original transport protection (where available).

5 Installation

5.1 Establishing the vacuum connection

A DANGER

Risk to life due to electric shock

An improperly earthed product is potentially fatal in the event of a fault.

- ► Connect the product galvanically with the earthed vacuum chamber.
- ► Ensure that the connection complies with the requirements of a protective bonding according to EN 61010. (CF and VCR connections comply with this requirement.)
- Use electrically conductive centering rings and circlips for KF connections.

WARNING

Risk of injury resulting from overpressure in the vacuum system

Opening tensioning pieces with an overpressure > 1000 hPa in the vacuum system can lead to injuries as a result of flying parts, and escaping process medium could prove harmful to health.

Elastomer seals in KF connections (e.g. O-rings) are not resistant to pressures > 2500 hPa. This could prove harmful to health due to escaping process medium.

- ▶ Do not open any tensioning pieces when overpressure is prevalent in the vacuum system.
- Use suitable tensioning pieces for overpressure.
- Use tensioning pieces which can only be opened and closed using a tool (e.g. tightening strapcirclip).
- Use sealing rings with an outer centering ring.

NOTICE

Impairment from contamination and damage

Touching the devices or components with bare hands increases the desorption rate and leads to incorrect measurements. Dirt (e.g. dust, fingerprints, etc.) and damage impair the function.

- ► When working on high or ultra high vacuum systems, always wear clean, lint-free and powder-free laboratory gloves.
- Only use clean tools.
- ▶ Make sure that the connection flanges are free of grease.
- Remove protective caps and protective covers from flanges and connections only when necessary.
- ► Carry out all work in a well lit area.

NOTICE

Damage caused by vibrations

Vibrations and strikes destroy the ceramic sensor, which is sensitive to shocks.

- ► Treat the gauge carefully.
- Avoid vibrations and strikes.
- ▶ Do not drop the gauge.

Prerequisites

- Appropriate ambient conditions
- Operating temperature within permissible range
- Adequate room available for electrical connection (e.g. permissible bending radii for cables)

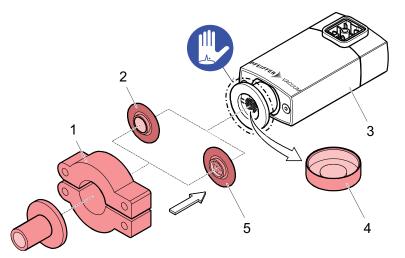


Fig. 2: Establishing the vacuum connection

- 1 Tensioning piece
- 2 Seal with centering ring
- 3 Electronic unit
- 4 Protective cap
- 5 Seal with centering ring and filter

Procedure

- 1. Ensure where possible that the gauge is not exposed to any vibrations during operation, as vibrations in general will lead to deviations in the measured values.
- Recommendation: Assemble the gauge in a horizontal to upright position (flange at the bottom) in order to prevent any condensate or particles entering the measuring chamber.
- 3. Ensure that the button of the gauge can be easily accessed with the stylus once fitted.
- 4. Recommendation: Fit a seal with centering ring and filter for applications susceptible to pollution and to protect the measuring system against contamination.
- 5. Remove the protective cap and store in a safe place.
- 6. Assemble the gauge with vacuum components from the <u>Pfeiffer Vacuum Components Shop</u> on the vacuum system.

5.2 Establishing the electric connection

A DANGER

Danger to life due to dangerous contact voltage

Voltages above 30 V (AC) or 60 V (DC) are considered dangerous in accordance with EN 61010. If you come into contact with dangerous contact voltage, this can result in injury through electric shocks or even death.

- Only connect the product to devices which meet the following criteria:
 - Requirements of the earthed protective extra-low voltage (PELV)
 - Limited power source (LPS) Class 2
- Secure the line to the product.
 - Pfeiffer Vacuum measuring and control equipment complies with this requirement.

NOTICE

Damage sustained as a result of improper connection

Improper connection, incorrect polarity or impermissible supply voltage will damage the gauge.

- ▶ Always connect the supply earth (Pin 5) with the earth for the supply unit.
- ► Always connect the shielding (Pin 6) with the earth for the supply unit.

Required tools

- · Crosshead screwdriver
- Torque wrench (≤ 0.2 Nm)

Required materials

- Measurement cable for a Pfeiffer vacuum total pressure measuring and control unit from the ActiveLine accessories range
- Self-fabricated measurement cable for an evaluation unit provided by the customer
- Hirschmann cable socket

Establishing the electric connection

- 1. Connect the measurement cable to the gauge.
- 2. Tighten the locking screw on the Hirschmann cable socket.
 - Tightening torque: ≤ 0.2 Nm
- 3. Connect the gauge to a Pfeiffer Vacuum total pressure measuring and control unit, or to an evaluation unit provided by the customer.

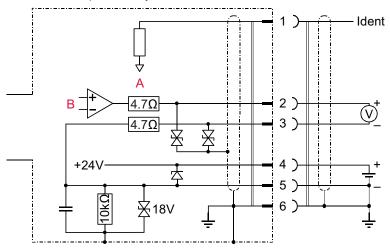


Fig. 3: Connection diagram

- Supply earth Measuring signal
- Identification
- Measuring signal
- Signal earth
- 5
- Supply
 Supply earth (GND)
 Screening, shielding

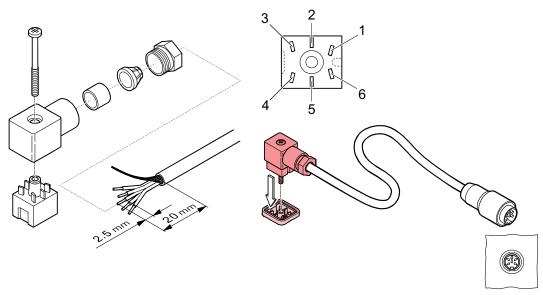


Fig. 4: Measurement cable and Hirschmann cable socket

Manufacturing a measurement cable

You can find additional information regarding measurement cable type and conductor cross-sections in the technical data.

- 1. Observe the following steps to ensure optimum signal quality, whereby ground loops, differences in potential or EMC will influence the measuring signal.
- 2. Use a cable with braided shield.

- 3. Connect the supply earth directly with the protective earth for power supply pack.
- 4. Use a differential measuring input and separate signal earth and supply earth.
- 5. Ensure that the potential difference for surge protection between supply earth and housing is \leq 6 V.
- 6. Assemble the Hirschmann cable socket.

Assembling the Hirschmann cable socket

- 1. Prepare the Hirschmann cable socket as shown in the "Measurement cable and Hirschmann cable socket" diagram.
- 2. Solder in the connection cable as prescribed in the terminal connection diagram.
- 3. Assemble the Hirschmann cable socket.

6 Operation

Once the supply voltage has been established, the measuring signal is available at the electrical connection between pins 2 and 3.

Recommendations

- ▶ Respect the minimum stabilization period of 10 minutes.
- ▶ Respect the relation between measuring signal and pressure.
- ▶ Leave the gauge switched on at all times, regardless of the prevalent pressure.

6.1 Converting measuring signal and pressure

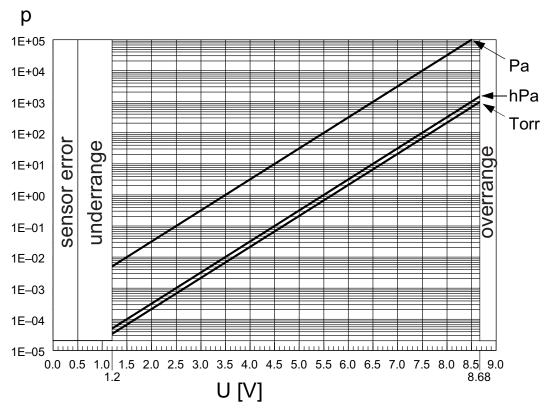


Fig. 5: Relation between measuring signal and pressure

 $p \quad \text{Pressure} \qquad \qquad \text{U} \quad \text{Measuring signal [V] (output voltage)}$

| Measuring signal (U) | Pressure (p) | Constant (c) 1) |
|----------------------|--------------|-----------------|
| [V] | [hPa] | 5.5 |
| | [mbar] | |
| | [Torr] | 5.625 |
| | [micron] | 2.625 |
| | [Pa] | 3.5 |

Tbl. 5: Constants for converting measuring signal and pressure

¹⁾ Dependent upon unit of pressure

Converting measuring signal and pressure

Validity range: 5 × 10⁻⁵ hPa < p < 1500 hPa

- ▶ Observe the constants for converting measuring signal and pressure.
- ► Convert measuring signal into pressure:

Convert pressure into measuring signal:

 $U = c + log_{10} p$

6.2 Ascertaining effective pressure with calibration factors

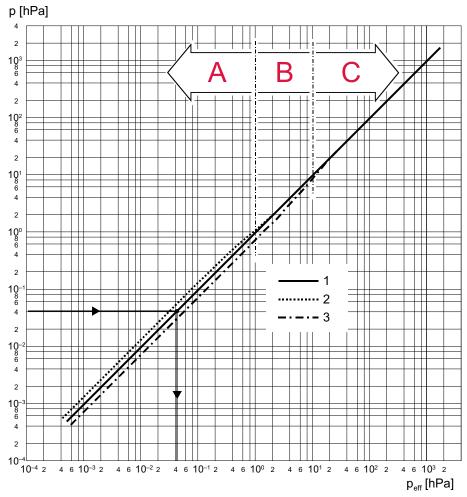


Fig. 6: Gas type dependence

- A Pirani sensor
- Mixed range Capacitive diaphragm sensor
- Air, oxygen (O₂), carbon monoxide (CO), nitrogen (N₂)
- Helium (He) Argon (Ar)

| Pressure range | Measuring principle | Gas type dependence |
|----------------------------------|-----------------------------------------------|----------------------------------------------|
| 10 to 1500 hPa | Capacitive diaphragm sensor | gas type-independent, no correction required |
| 1 to 10 hPa | Capacitive diaphragm sensor and Pirani sensor | Mixed range |
| 5 × 10 ⁻⁵ up to 1 hPa | Pirani sensor | proportional to pressure ²⁾ |

Tbl. 6: Gas type dependence

Calibration factors

| Gas type | Calibration factor (C) |
|---------------------------------------------------------------------------------|------------------------|
| Air, oxygen (O ₂), carbon monoxide (CO), nitrogen (N ₂) | 1.0 |
| Hydrogen (H ₂) | 0.5 |
| Carbon dioxide (CO ₂) | 0.9 |
| Water vapor | 0.5 |
| Helium (He) | 0.8 |
| Neon (Ne) | 1.4 |
| Argon (Ar) | 1.7 |
| Krypton (Kr) | 2.4 |
| Xenon (Xe) | 3.0 |
| Freon 12 | 0.7 |
| The calibration factors provided are mean values. | |

Tbl. 7: Calibration factors for the Pirani pressure range < 1 hPa

Entering the calibration factor in a total pressure measuring and control unit

▶ Enter the calibration factor to correct the displayed measured value.

Calculating pressure for gases other than air

► Calculate the effective pressure using the following formula:

 $P_{eff} = C \times p$

- P_{eff} = Effective pressure
- **C** = Calibration factor
- **p** = Displayed pressure (gauge calibrated for air)

²⁾ The displayed measured value applies to dry air, oxygen (O₂), carbon monoxide (CO) and nitrogen (N₂). For other gases, you need the calibration factors to convert the measured value.

7 Disassembly

A DANGER

Risk to life due to electric shock

An improperly earthed product is potentially fatal in the event of a fault.

- ► Connect the product galvanically with the earthed vacuum chamber.
- ► Ensure that the connection complies with the requirements of a protective bonding according to EN 61010. (CF and VCR connections comply with this requirement.)
- ▶ Use electrically conductive centering rings and circlips for KF connections.

WARNING

Health hazard through poisoning from toxic contaminated components or devices

Toxic process media result in contamination of devices or parts of them. During maintenance work, there is a risk to health from contact with these poisonous substances. Illegal disposal of toxic substances causes environmental damage.

- ► Take suitable safety precautions and prevent health hazards or environmental pollution by toxic process media.
- Decontaminate affected parts before carrying out maintenance work.
- ► Wear protective equipment.

WARNING

Risk of injury resulting from overpressure in the vacuum system

Opening tensioning pieces with an overpressure > 1000 hPa in the vacuum system can lead to injuries as a result of flying parts, and escaping process medium could prove harmful to health.

Elastomer seals in KF connections (e.g. O-rings) are not resistant to pressures > 2500 hPa. This could prove harmful to health due to escaping process medium.

- ▶ Do not open any tensioning pieces when overpressure is prevalent in the vacuum system.
- ▶ Use suitable tensioning pieces for overpressure.
- ► Use tensioning pieces which can only be opened and closed using a tool (e.g. tightening strapcirclin)
- ▶ Use sealing rings with an outer centering ring.

NOTICE

Impairment from contamination and damage

Touching the devices or components with bare hands increases the desorption rate and leads to incorrect measurements. Dirt (e.g. dust, fingerprints, etc.) and damage impair the function.

- When working on high or ultra high vacuum systems, always wear clean, lint-free and powder-free laboratory gloves.
- Only use clean tools.
- ▶ Make sure that the connection flanges are free of grease.
- Remove protective caps and protective covers from flanges and connections only when necessary.
- Carry out all work in a well lit area.

NOTICE

Damage caused by vibrations

Vibrations and strikes destroy the ceramic sensor, which is sensitive to shocks.

- ► Treat the gauge carefully.
- Avoid vibrations and strikes.
- Do not drop the gauge.

Prerequisites

- Vacuum system vented to atmospheric pressure
- Supply voltage switched off

Required tool

• Crosshead screwdriver

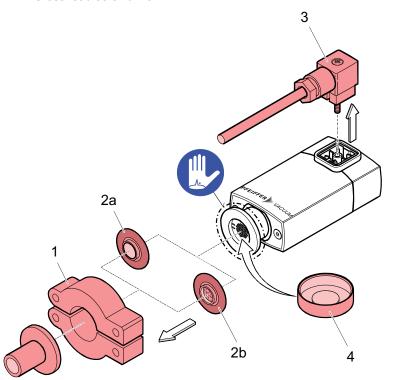


Fig. 7: Disassembling the gauge

- Tensioning piece
 Seal with centering ring
 Seal with centering ring and filter
- Measurement cable
- Protective cap

Disassembling the gauge

- 1. Loosen the locking screw of the Hirschmann cable socket on the gauge.
- 2. Disconnect the measurement cable from the gauge.
- 3. Disassemble the gauge from the vacuum system.
- 4. Fit the protective cap onto the connection flange.

8 Maintenance

WARNING

Health hazard through poisoning from toxic contaminated components or devices

Toxic process media result in contamination of devices or parts of them. During maintenance work, there is a risk to health from contact with these poisonous substances. Illegal disposal of toxic substances causes environmental damage.

- ► Take suitable safety precautions and prevent health hazards or environmental pollution by toxic process media.
- ▶ Decontaminate affected parts before carrying out maintenance work.
- Wear protective equipment.



Maintenance in the Pfeiffer Vacuum Service Center

Pfeiffer Vacuum offers a complete maintenance service for all products.

Pfeiffer Vacuum recommends: Contact your Pfeiffer Vacuum Service Center to arrange the maintenance of defective products and components.



Cleaning in the Pfeiffer Vacuum Service Center

Pfeiffer Vacuum recommends: Contact your nearest Pfeiffer Vacuum Service Center to arrange the cleaning of heavily-soiled products and components.



Loss of warranty claims

The following will result in the loss of the warranty:

- Damage to or removal of a closure seal
- Opening the device during the warranty period

Contact the Pfeiffer Vacuum Service Center in the event of process-related shorter maintenance intervals.



First read through the sections completely

Read the section with the work instructions through completely first before you commence with work.

Utilization in other climatic conditions, long-term operation, extreme temperatures, a different mounting orientation and aging or contamination can lead to a zero point shift in the Pirani measuring circuit. A zero point shift will necessitate recalibration or cleaning.

8.1 Calibrating the gauge

Pfeiffer Vacuum has calibrated the gauge to standard values at the factory.



Setting the gauge to other pressure values

You can set the gauge to other pressure values. However, the precise pressure value (reference measurement) is required in order to do this.

The gauge always performs the calibration on the diaphragm sensor automatically if you operate the gauge for at least 15 minutes with pressures $< 1 \times 10^{-2}$ hPa.

Required tool

• Stylus (max. Ø 1.1 mm)

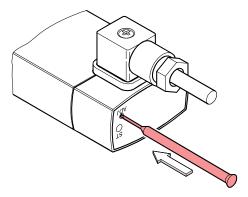


Fig. 8: Calibrating the gauge

Preparing for calibration

- 1. Ensure the same installation and ambient conditions as those applicable for normal use.
- 2. Check the filter for contamination as required.
- 3. Replace the filter if the filter is contaminated or damaged.
- 4. Put the gauge into operation.

Performing an HV calibration

- 1. Perform commissioning of the gauge.
- 2. Evacuate the vacuum system to p << 10⁻⁵ hPa.
- 3. Wait for at least 2 minutes.
- 4. Press the "ADJ" button using a stylus.
 - The gauge calibrates to 5 × 10⁻⁵ hPa (standard).
- 5. Repeat the calibration if the gauge does **not** display a pressure of 4.99 x 10⁻⁵ hPa at the measuring signal output.
 - The calibration was not successful this time.

Performing an ATM calibration

- 1. Perform commissioning of the gauge.
- 2. Operate the gauge for at least 10 minutes at atmospheric pressure.
- 3. Press the "ADJ" button briefly using a stylus.
 - The gauge calibrates to 1000 hPa (standard).

8.2 Cleaning of components

A DANGER

Electric shocks due to moisture penetrating into the device

Moisture that has penetrated into the device results in personal injury through electric shocks.

- ▶ Only operate the device in a dry environment.
- ▶ Operate the device away from fluids and humidity sources.
- ▶ Do not switch on the device if fluid has penetrated into it, instead contact Pfeiffer Vacuum Service
- Always disconnect the current supply before cleaning the device.

WARNING

Health hazards due to cleaning agent

The cleaning agents used cause health hazards.

- ▶ When handling cleaning agents, observe the applicable regulations.
- ▶ Adhere to safety measures regarding handling and disposal of cleaning agents.
- ▶ Be aware of potential reactions with product materials.

NOTICE

Damage caused by penetrating moisture

Penetrating moisture, e.g. through condensation or dripping water, damages the device.

- ▶ Protect the device against moisture penetrating.
- Only operate the device in a clean and dry environment.
- Operate the device away from fluids and humidity sources.
- ► Take special precautions if there is a risk of dripping water.
- ▶ Do not switch on the device if fluid has penetrated into it, instead contact the Pfeiffer Vacuum Service Center.

NOTICE

Damage caused by unsuitable cleaning agents

Unsuitable cleaning agents damage the product.

- Do not use solvents as they attack the surface.
- Do not use any aggressive or abrasive cleaning agents.

Required consumables

- Industrial alcohol
- Cloth (soft, lint-free)

External cleaning of the device

- 1. Always use a cloth soaked in industrial alcohol for external cleaning.
- 2. Allow the surfaces to dry thoroughly after cleaning.

8.3 Disassembling the gauge

NOTICE

Impairment from contamination and damage

Touching the devices or components with bare hands increases the desorption rate and leads to incorrect measurements. Dirt (e.g. dust, fingerprints, etc.) and damage impair the function.

- When working on high or ultra high vacuum systems, always wear clean, lint-free and powder-free laboratory gloves.
- Only use clean tools.
- Make sure that the connection flanges are free of grease.
- Remove protective caps and protective covers from flanges and connections only when necessary.
- Carry out all work in a well lit area.

Required tool

• Allen key, WAF 2

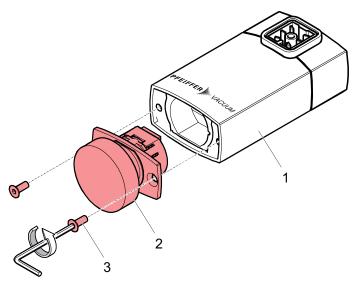


Fig. 9: Disassembling the gauge

- 1 Electronic unit
- 2 Measurement system
- 3 Interior hexagon socket screw (2×)

Procedure

- 1. Disassemble the gauge from the vacuum system.
- 2. Unscrew the interior hexagon socket screws from the electronic unit.
- 3. Remove the measurement system from the electronic unit without any rotary movement.

8.4 Assembling the gauge

NOTICE

Impairment from contamination and damage

Touching the devices or components with bare hands increases the desorption rate and leads to incorrect measurements. Dirt (e.g. dust, fingerprints, etc.) and damage impair the function.

- ► When working on high or ultra high vacuum systems, always wear clean, lint-free and powder-free laboratory gloves.
- Only use clean tools.
- ▶ Make sure that the connection flanges are free of grease.
- Remove protective caps and protective covers from flanges and connections only when necessary.
- Carry out all work in a well lit area.

Required tool

• Allen key, WAF 2

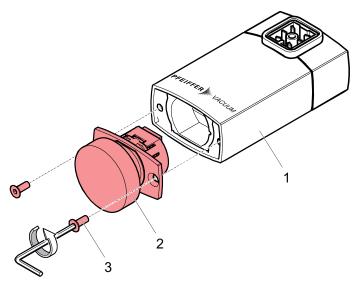


Fig. 10: Assembling the gauge

- Electronic unit Measurement system
- 3 Interior hexagon socket screw (2×)

Procedure

- 1. Insert the measurement system into the electronic unit without any rotary movement.
- 2. Tighten the interior hexagon socket screws.
- 3. Connect the gauge to the vacuum system.

9 Malfunctions



Warranty

Malfunctioning of the equipment as a direct result of contamination or wear, as well as wear parts, is not covered by the warranty.



Rectifying malfunctions (reset)

In the event of a malfunction, Pfeiffer Vacuum recommends disconnecting the supply voltage, and then reconnecting after 5 seconds.

9.1 Troubleshooting

| Disturbance | Possible cause | Remedy |
|-----------------------------------------|------------------------------------------------------------------|--------------------------------------------------------------------------|
| Continuous measuring signal approx. 0 V | Measurement cable defective or incorrectly connected | Check the measurement cable. |
| | No supply | Switch the supply on. |
| LED "ST" lights up red | Gauge in undefined state | Switch the gauge off, wait 5 seconds and then switch it back on (reset). |
| | Electronic unit not attached to the measurement system correctly | Check the connection. |
| | Electronic unit and measurement system incompatible | Replace the measurement system. |
| | Pirani sensor defective | Replace the gauge. |
| | Diaphragm sensor defective | Replace the gauge. |
| LED "ST" flashes red | EEPROM error | Switch the gauge off, wait 5 seconds and then switch it back on (reset). |
| | | Replace the gauge. |

Tbl. 8: Malfunctions

9.2 Detecting errors on the measurement system

If you are fairly certain of the cause of a measurement system malfunction, you can carry out an approximate diagnosis using an ohmmeter. Venting of the vacuum system is not necessary.

Prerequisite

· Electronic unit removed

Equipment required

Ohmmeter

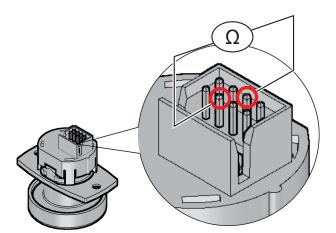


Fig. 11: Contact pins of the measurement system

| Setpoint range | Reasons for values being outside of setpoint range | |
|----------------|----------------------------------------------------|--|
| 40 ±1 Ω | >> 40 Ω: Pollution | |
| | << 40 Ω: Pollution | |
| | ∞: Filament defective | |

Tbl. 9: Measurement

Performing a resistance test

- 1. Perform the resistance test at the contact pins of the measurement system using an ohmmeter.
- 2. Replace the complete measurement system if the measured value is outside of the setpoint range.

10 Shipping

WARNING

Risk of poisoning from contaminated products

Where products that contain harmful substances are shipped for maintenance or repair purposes, the safety of service personnel is at risk.

► Comply with the instructions for safe shipping.



Decontamination subject to charge

Pfeiffer Vacuum decontaminates products not clearly declared "Free of contamination" at your expense.

Instructions for safe shipping

- ▶ Do not ship microbiological, explosive or radioactively contaminated products.
- ▶ Observe the shipping guidelines for the participating countries and transport companies.
- ► Highlight any potential dangers on the outside of the packaging.
- ▶ Download the explanation for contamination at <u>Pfeiffer Vacuum Service</u>.
- ► Always enclose a completed declaration of contamination.

11 Recycling and disposal

WARNING

Health hazard through poisoning from toxic contaminated components or devices

Toxic process media result in contamination of devices or parts of them. During maintenance work, there is a risk to health from contact with these poisonous substances. Illegal disposal of toxic substances causes environmental damage.

- ► Take suitable safety precautions and prevent health hazards or environmental pollution by toxic process media.
- ▶ Decontaminate affected parts before carrying out maintenance work.
- ▶ Wear protective equipment.



Environmental protection

You **must** dispose of the product and its components in accordance with all applicable regulations for protecting people, the environment and nature.

- Help to reduce the wastage of natural resources.
- Prevent contamination.



Environmental protection

The product and its components **must be disposed of in accordance with the applica- ble regulations relating to environmental protection and human health**, with a view to reducing natural resource wastage and preventing pollution.

11.1 General disposal information

Pfeiffer Vacuum products contain materials that you must recycle.

- ▶ Dispose of our products according to the following:
 - Iron
 - Aluminium
 - Copper
 - Synthetic
 - Electronic components
 - Oil and fat, solvent-free
- ▶ Observe the special precautionary measures when disposing of:
 - Fluoroelastomers (FKM)
 - Potentially contaminated components that come into contact with media

11.2 Dispose of gauges

Pfeiffer Vacuum gauges contain materials that you must recycle.

- 1. Dismantle the electronic unit.
- 2. Decontaminate the components that come into contact with process gases.
- 3. Separate the components into recyclable materials.
- 4. Recycle the non-contaminated components.
- 5. Dispose of the product or components in a safe manner according to locally applicable regulations.

12 Service solutions by Pfeiffer Vacuum

We offer first-class service

High vacuum component service life, in combination with low downtime, are clear expectations that you place on us. We meet your needs with efficient products and outstanding service.

We are always focused on perfecting our core competence – servicing of vacuum components. Once you have purchased a product from Pfeiffer Vacuum, our service is far from over. This is often exactly where service begins. Obviously, in proven Pfeiffer Vacuum quality.

Our professional sales and service employees are available to provide you with reliable assistance, worldwide. Pfeiffer Vacuum offers an entire range of services, from <u>original replacement parts</u> to <u>service</u> contracts.

Make use of Pfeiffer Vacuum service

Whether preventive, on-site service carried out by our field service, fast replacement with mint condition replacement products, or repair carried out in a <u>Service Center</u> near you – you have various options for maintaining your equipment availability. You can find more detailed information and addresses on our homepage, in the Pfeiffer Vacuum Service section.

You can obtain advice on the optimal solution for you, from your <u>Pfeiffer Vacuum representative</u>.

For fast and smooth service process handling, we recommend the following:



- 1. Download the up-to-date form templates.
 - Explanations of service requests
 - Service requests
 - Contamination declaration
- Remove and store all accessories (all external parts, such as valves, protective screens, etc.).
- b) If necessary, drain operating fluid/lubricant.
- c) If necessary, drain coolant.
- 2. Complete the service request and contamination declaration.






- 3. Send the forms by email, fax, or post to your local Service Center.


4. You will receive an acknowledgment from Pfeiffer Vacuum.

Submission of contaminated products

No microbiological, explosive, or radiologically contaminated products will be accepted. Where products are contaminated, or the contamination declaration is missing, Pfeiffer Vacuum will contact you before starting service work. Depending on the product and degree of pollution, **additional decontamination costs** may be incurred.

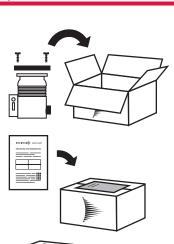

- Prepare the product for transport in accordance with the provisions in the contamination declaration.
- Neutralize the product with nitrogen or dry air.
 Seal all openings with blind flanges, so that they are airtight.
- c) Shrink-wrap the product in suitable protective foil.d) Package the product in suitable, stable transport containers only.
- e) Maintain applicable transport conditions.
- 6. Attach the contamination declaration to the outside of the packag-

 

7. Now send your product to your local Service Center.



8. You will receive an acknowledgment/quotation, from Pfeiffer Vac-

PFEIFFER

VACUUM

Our sales and delivery conditions and repair and maintenance conditions for vacuum devices and components apply to all service orders.

13 Spare parts

Ordering spare parts

- ▶ Have the part number to hand, along with other details from the rating plate as required.
- ► Install original spare parts only.

| Description | Order number |
|-------------------------------------------|---------------|
| Replacement measuring system DN 16 ISO-KF | PT 120 041 -T |

14 Accessories



View the range of accessories for ActiveLine on our website.

14.1 Accessory information

Measurement cable

Measurement cable in different lengths for connecting to a Pfeiffer Vacuum total pressure measuring and control unit

Line connector (Hirschmann plug)

Cable socket for fabrication of the application-specific connecting cable

Seals with centering ring and filter

Filters available in different pore sizes to protect the measuring system against contamination in the event of potential contaminating applications

14.2 Ordering accessories

| Description | Order number |
|--------------------------------------------------------------------------------|---------------|
| Measurement Cable, 3 m | PT 448 250 -T |
| Measurement Cable, 6 m | PT 448 251 -T |
| Measurement Cable, 10 m | PT 448 252 -T |
| Mating connector | B4707283MA |
| Centering ring with sintered metal filter, pore size 4 µm, FPM/stainless steel | PT 120 132 -T |

15 Technical data and dimensions

15.1 General

| | mbar | bar | Pa | hPa | kPa | Torr mm Hg |
|--------------|------|-------------------------|---------------------|------|----------------------|------------------------|
| mbar | 1 | 1 · 10 ⁻³ | 100 | 1 | 0.1 | 0.75 |
| bar | 1000 | 1 | 1 · 10 ⁵ | 1000 | 100 | 750 |
| Pa | 0.01 | 1 · 10 ⁻⁵ | 1 | 0.01 | 1 · 10 ⁻³ | 7.5 · 10 ⁻³ |
| hPa | 1 | 1 · 10 ⁻³ | 100 | 1 | 0.1 | 0.75 |
| kPa | 10 | 0.01 | 1000 | 10 | 1 | 7.5 |
| Torr mm Hg | 1.33 | 1.33 · 10 ⁻³ | 133.32 | 1.33 | 0.133 | 1 |

1 Pa = 1 N/m²

Tbl. 10: Conversion table: Pressure units

| | mbar l/s | Pa m³/s | sccm | Torr I/s | atm cm ³ /s |
|------------------------|-------------------------|-------------------------|------|-------------------------|-------------------------|
| mbar l/s | 1 | 0.1 | 59.2 | 0.75 | 0.987 |
| Pa m ³ /s | 10 | 1 | 592 | 7.5 | 9.87 |
| sccm | 1.69 · 10 ⁻² | 1.69 · 10 ⁻³ | 1 | 1.27 · 10 ⁻² | 1.67 · 10 ⁻² |
| Torr I/s | 1.33 | 0.133 | 78.9 | 1 | 1.32 |
| atm cm ³ /s | 1.01 | 0.101 | 59.8 | 0.76 | 1 |

Tbl. 11: Conversion table: Units for gas throughput

15.2 Technical data

| Parameter | | Value |
|---------------------------------------------------------------------|-----------------------------------------------------|-------------------------------------|
| Measuring range | | 5 × 10 ⁻⁵ up to 1500 hPa |
| Maximum pressure (absolute) | | ≤ 500 kPa |
| Burst pressure (absolu | te) | 1000 kPa |
| Measuring principle | 10 hPa up to 1500 hPa | Capacitive diaphragm sensor |
| | 1 up to 10 hPa | Mixed range |
| | 5 × 10 ⁻⁵ up to 1 hPa | Heat conduction according to Pirani |
| Accuracy (N ₂) | 5 × 10 ⁻⁴ up to 1 × 10 ⁻³ hPa | ±50 % of measured value |
| | 1 × 10 ⁻³ up to 100 hPa | ±15 % of measured value |
| | 100 to 950 hPa | ±5 % of measured value |
| | 950 to 1050 hPa | ±2.5 % of measured value |
| Repeatability (N ₂) 1 × 10 ⁻³ up to 1100 hPa | | ±2 % of measured value |
| Gauge calibration (HV) | | at < 10⁻⁵ hPa |
| Gauge calibration (ATM) | | at > 100 hPa |

Tbl. 12: Measured and pressure values

| Parameter | | Value |
|----------------------------------|---------------------------|--------------------------------|
| Output signal (measuring signal) | Voltage range | 0 to +8.68 V |
| | Measuring range | +1.2 to +8.68 V |
| | Error signal | 0 V (ex factory) |
| | Relation voltage-pressure | 1 V/decade, logarithmic |
| Output impedance | | 2 × 4.7 Ω, short circuit proof |
| Load impedance (minimum load) | | > 10 kΩ |

| Parameter | | Value |
|----------------------------------------------------|----------|--------------------------------------------|
| Response time | | < 30 ms |
| Gauge identification | | 3.01 kΩ |
| Supply voltage | | Class 2/LPS |
| | at gauge | +15 to +30 V DC |
| | Ripple | ≤ 1 V _{pp} |
| Power input | | ≤ 2.5 W |
| Fuse (to be connected in series) 3) | | 1 AT |
| Connection (electrical) | | Hirschmann GO 6 UM (6-pin, pins) |
| Measurement cable | | screened, 0.14 mm ² / conductor |
| Cable length | | ≤ 100 m |
| Earthing concept (see chapter "Establishing the el | | lectric connection", page 18) |
| Vacuum connection and signal earth | | connected with 10 kΩ |

Tbl. 13: Electrical data

| Parameter | | Value |
|-----------------|--------------|---------------------|
| Internal volume | DN 16 ISO-KF | 4.7 cm ³ |
| | DN 16 CF-F | 8 cm ³ |
| Weight | | 120 g |

Tbl. 14: Internal volume and weight

| Parameter | | Value |
|----------------------------|----------------|-------------------------|
| Relative humidity | Annual average | ≤ 65 % (non-condensing) |
| | at 60 days | ≤ 85 % (non-condensing) |
| Mounting orientation | | Arbitrary |
| Use | | Only in indoor areas |
| Installation altitude max. | | 2000 m MSL |
| Protection category | | IP40 |

Tbl. 15: Ambient conditions

| Parameter | Value |
|------------------------|---------------|
| Operation | +10 to +50 °C |
| Vacuum connection 4) | ≤ 80 °C |
| Filament ⁵⁾ | ≤ 160 °C |
| Storage | -20 to +65 °C |

Tbl. 16: Temperatures

| Parameter | Value |
|--------------------|------------------------|
| Vacuum connection | Stainless steel 1.4435 |
| Filament | Tungsten (W) |
| Vacuum feedthrough | Glass |

- 3) Pfeiffer Vacuum measuring and control equipment complies with this requirement.
- For horizontal installation. The technical data may deviate in measuring range, accuracy and repeatability for bake-out.
- 5) Cannot be influenced by the operator

| Parameter | Value |
|------------------|----------------------------------------|
| Screen | Stainless steel |
| Diaphragm | Ceramic |
| Other substances | Ni, NiFe, stainless steel 1.4301, SnAg |

Tbl. 17: Substances in contact with the media

15.3 Dimensions

Dimensions in mm.

45

00

16.5

DN 16 ISO-KF

DN 16 CF-F

Fig. 12: Dimensions



ETL LISTED

The product PCR 280

- conforms to the UL standard UL 61010-1.
- is certified to the CAN/CSA standard CAN/CSA C22.2 No. 61010-1-12.

Declaration of conformity

Declaration for product(s) of the type:

Pirani/capacitive gauge

PCR 280

We hereby declare that the listed product satisfies all relevant provisions of the following **European Directives**.

Electromagnetic compatibility 2014/30/EU

Restriction of the use of certain hazardous substances 2011/65/EU Restriction of the use of certain hazardous substances, delegated directive 2015/863/EU

Harmonized standards and applied national standards and specifications:

DIN EN 61000-6-2:2006-03 DIN EN 61000-6-3:2011-09 DIN EN 61010-1:2011-07 DIN EN 61326-1:2013-07

Signature:

Pfeiffer Vacuum GmbH Berliner Straße 43 35614 Asslar Germany

(Daniel Sälzer) Managing Director Asslar, 2020-01-27





VACUUM SOLUTIONS FROM A SINGLE SOURCE

Pfeiffer Vacuum stands for innovative and custom vacuum solutions worldwide, technological perfection, competent advice and reliable service.

COMPLETE RANGE OF PRODUCTS

From a single component to complex systems:

We are the only supplier of vacuum technology that provides a complete product portfolio.

COMPETENCE IN THEORY AND PRACTICE

Benefit from our know-how and our portfolio of training opportunities! We support you with your plant layout and provide first-class on-site service worldwide.



Are you looking for a perfect vacuum solution? Please contact us

Pfeiffer Vacuum GmbH Headquarters • Germany T +49 6441 802-0 info@pfeiffer-vacuum.de

www.pfeiffer-vacuum.com

